



Release Notes for Cisco ONS 15530 for Cisco IOS Release 12.1(12c)EV

This document describes caveats for Cisco IOS Release 12.1(12c)EV for the Cisco ONS 15530.

Date: January 27, 2003

Text Part Number: OL-3630-01

Contents

This document includes the following information:

- [Introduction, page 1](#)
- [System Requirements, page 2](#)
- [New and Changed Information, page 16](#)
- [Caveats, page 18](#)
- [Limitations and Restrictions, page 31](#)
- [Related Documentation, page 32](#)
- [Obtaining Documentation, page 32](#)
- [Obtaining Technical Assistance, page 33](#)

Introduction

The Cisco ONS 15530 is a modular, scalable optical switching and aggregation platform designed to supplement the Cisco ONS 15540 ESP. With the Cisco ONS 15540 ESP, users can take advantage of the availability of dark fiber to build a common infrastructure that supports data, SAN (storage area network), and TDM (time-division multiplexing) traffic. For more information about DWDM technology and applications, refer to the [Introduction to DWDM Technology](#) publication and the [Cisco ONS 15530 Planning Guide](#).



Corporate Headquarters:
Cisco Systems, Inc., 170 West Tasman Drive, San Jose, CA 95134-1706 USA

Copyright © 2003. Cisco Systems, Inc. All rights reserved.

System Requirements

This section describes the system requirements for Cisco IOS Release 12.1(10)EV4 and includes the following sections:

- [Memory Requirements, page 2](#)
- [Hardware Supported, page 2](#)
- [Determining the Software Version, page 15](#)
- [Upgrading the System Image, page 15](#)
- [Feature Set Table, page 15](#)

Memory Requirements

The DRAM memory configuration is 64 MB, which is the default for the Cisco ONS 15530.

Hardware Supported

[Table 1](#) lists the hardware components supported on the Cisco ONS 15530 and the minimum software version required. See the [“Determining the Software Version” section on page 15](#) for information on determining your software version.

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements

Component	Part Number	Description	Minimum Software Version Required
Chassis	15530-CHAS-N	15530-CHAS-N chassis, NEBS Version	12.1(10)EV4
Chassis	15530-CHAS-E	15530-CHAS-E chassis, ETSI Version	12.1(10)EV4
Power supplies	15530-PWR-AC	120 to 240 VAC power supply	12.1(10)EV4
	15530-PWR-DC	Power supply –48 VDC	12.1(10)EV4
CPU switch module	15530-CPU	ONS 15530 CPU switch module	12.1(10)EV4
Carrier motherboard	15530-LCMB-0100	Carrier motherboard (supports OSC, WB-VOA, and PB-OE modules)	12.1(10)EV4
OADM modules without OSC	15530-MDXA-04A0	4-channel Band A	12.1(10)EV4
	15530-MDXA-04B0	4-channel Band B	12.1(10)EV4
	15530-MDXA-04C0	4-channel Band C	12.1(10)EV4
	15530-MDXA-04D0	4-channel Band D	12.1(10)EV4
	15530-MDXA-04E0	4-channel Band E	12.1(10)EV4
	15530-MDXA-04F0	4-channel Band F	12.1(10)EV4
	15530-MDXA-04G0	4-channel Band G	12.1(10)EV4
	15530-MDXA-04H0	4-channel Band H	12.1(10)EV4
OADM modules with OSC	15530-MDXB-04A0	4-channel Band A	12.1(10)EV4
	15530-MDXB-04B0	4-channel Band B	12.1(10)EV4
	15530-MDXB-04C0	4-channel Band C	12.1(10)EV4
	15530-MDXB-04D0	4-channel Band D	12.1(10)EV4
	15530-MDXB-04E0	4-channel Band E	12.1(10)EV4
	15530-MDXB-04F0	4-channel Band F	12.1(10)EV4
	15530-MDXB-04G0	4-channel Band G	12.1(10)EV4
	15530-MDXB-04H0	4-channel Band H	12.1(10)EV4

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
MM transponder modules with splitter	15530-TSP1-0111	Ch 1- 2 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0311	Ch 3- 4 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0511	Ch 5 - 6 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0711	Ch 7- 8 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0911	Ch 9-10 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1111	Ch 11-12 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1311	Ch 13-14 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1511	Ch 15-16 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1711	Ch 17-18 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1911	Ch 19-20 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2111	Ch 21-22 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2311	Ch 23- 24 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2511	Ch 25-26 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2711	Ch 27-28 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2911	Ch 29-30 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
15530-TSP1-3111	Ch 31-32 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4	

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
MM transponder modules without splitter	15530-TSP1-0121	Ch 1-2 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0321	Ch 3-4 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0521	Ch 5-6 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0721	Ch 7-8 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-0921	Ch 9-10 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1121	Ch 11-12 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1321	Ch 13-14 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1521	Ch 15-16 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1721	Ch 17-18 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-1921	Ch 19-20 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2121	Ch 21-22 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2321	Ch 23- 24 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2521	Ch 25-26 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2721	Ch 27-28 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
	15530-TSP1-2921	Ch 29-30 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4
15530-TSP1-3121	Ch 31-32 — 1310-nm MM 16 to 622 Mbps with SC	12.1(10)EV4	

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
SM transponder modules with splitter	15530-TSP1-0112	Ch 1-2—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0312	Ch 3-4—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0512	Ch 5-6—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0712	Ch 7-8—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0912	Ch 9-10—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1112	Ch 11-12—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1312	Ch 13-14—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1512	Ch 15-16—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1712	Ch 17-18—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1912	Ch 19-20—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2112	Ch 21-22—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2312	Ch 23-24—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2512	Ch 23-24—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2712	Ch 25-26—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2912	Ch 27-28—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
15530-TSP1-3112	Ch 29-30—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4	

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
SM transponder modules without splitter	15530-TSP1-0122	Ch 1-2—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0322	Ch 3-4—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0522	Ch 5-6—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0722	Ch 7-8—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-0922	Ch 9-10—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1122	Ch 11-12—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1322	Ch 13-14—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1522	Ch 15-16—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1722	Ch 17-18—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-1922	Ch 19-20—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2122	Ch 21-22—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2322	Ch 23-24—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2522	Ch 23-24—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2722	Ch 25-26—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
	15530-TSP1-2922	Ch 27-28—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4
15530-TSP1-3122	Ch 29-30—1310-nm SM 16 Mbps to 2.5 Gbps with SC	12.1(10)EV4	
Multiplexing line cards	15530-LCMB-0200	ONS 15530 10-Port ESCON Multiplexing Line Card	12.1(10)EV4
	15530-FCGE-8P	ONS 15530 8-Port Fibre Channel/Gigabit Ethernet Multiplexing Line Card	12.1(12c)EV

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
2.5-Gbps ITU trunk cards	15530-ITU3-XX10	ONS 15530 Ch XX 2.5Gbps ITU Trunk Card MU w/ Splitter	12.1(12c)EV
	15530-ITU3-XX20	ONS 15530 Ch XX 2.5Gbps ITU Trunk Card MU w/o Splitter	12.1(12c)EV

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
10-Gbps ITU trunk line cards with splitter (1550 nm)	15530-ITU2-0110	CH 1—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0210	CH 2—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0310	CH 3—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0410	CH 4—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0510	CH 5—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0610	CH 6—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0710	CH 7—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0810	CH 8—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-0910	CH 9—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1010	CH 10—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1110	CH 11—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1210	CH 12—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1310	CH 13—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1410	CH 14—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1510	CH 15—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1610	CH 16—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1710	CH 17—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1810	CH 18—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-1910	CH 19—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2010	CH 20—10-Gbps ITU trunk line card with splitter	12.1(10)EV4

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
	15530-ITU2-2110	CH 21—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2210	CH 22—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2310	CH 23—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2410	CH 24—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2510	CH 25—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2610	CH 26—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2710	CH 27—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2810	CH 28—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-2910	CH 29—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-3010	CH 30—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-3110	CH 31—10-Gbps ITU trunk line card with splitter	12.1(10)EV4
	15530-ITU2-3210	CH 32—10-Gbps ITU trunk line card with splitter	12.1(10)EV4

Table 1 *Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)*

Component	Part Number	Description	Minimum Software Version Required
10-Gbps ITU trunk line cards without splitter (1550 nm)	15530-ITU2-0120	CH 1—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0220	CH 2—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0320	CH 3—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0420	CH 4—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0520	CH 5—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0620	CH 6—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0720	CH 7—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0820	CH 8—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-0920	CH 9—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1020	CH 10—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1120	CH 11—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1220	CH 12—10-Gbps ITU trunk line card without splitter	12.1(10)EV4

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
	15530-ITU2-1320	CH 13—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1420	CH 14—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1520	CH 15—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1620	CH 16—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1720	CH 17—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1820	CH 18—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-1920	CH 19—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2020	CH 20—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2120	CH 21—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2220	CH 22—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2320	CH 23—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2420	CH 24—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2520	CH 25—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2620	CH 26—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2720	CH 27—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2820	CH 28—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-2920	CH 29—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-3020	CH 30—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-3120	CH 31—10-Gbps ITU trunk line card without splitter	12.1(10)EV4
	15530-ITU2-3220	CH 32—10-Gbps ITU trunk line card without splitter	12.1(10)EV4

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
10-GE uplink card	15530-10GE-UPLINK	ONS 15530 10-Gbps uplink, 1310nm with SC	12.1(10)EV
WB-VOA module	15500-VOA-0100	Single wide-band variable optical attenuator	12.1(10)EV4
	15500-VOA-0200	Dual wide-band variable optical attenuator	12.1(10)EV4
Single-band PB-OE module	15500-PEQ-01A0	Single-band optical equalizer Band A	12.1(10)EV4
	15500-PEQ-01B0	Single-band optical equalizer Band B	12.1(10)EV4
	15500-PEQ-01C0	Single-band optical equalizer Band C	12.1(10)EV4
	15500-PEQ-01D0	Single-band optical equalizer Band D	12.1(10)EV4
	15500-PEQ-01E0	Single-band optical equalizer Band E	12.1(10)EV4
	15500-PEQ-01F0	Single-band optical equalizer Band F	12.1(10)EV4
	15500-PEQ-01G0	Single-band optical equalizer Band G	12.1(10)EV4
	15500-PEQ-01H0	Single-band optical equalizer Band H	12.1(10)EV4
Dual-band PB-OE module	15500-PEQ-02AB	Dual band optical equalizer Band AB	12.1(10)EV4
	15500-PEQ-02CD	Dual band optical equalizer Band CD	12.1(10)EV4
	15500-PEQ-02EF	Dual band optical equalizer Band EF	12.1(10)EV4
	15500-PEQ-02GH	Dual band optical equalizer Band GH	12.1(10)EV4
Protection switch module	15530-PSM-01	ONS 15530 Protection Switch Module	12.1(12c)EV

Table 1 Cisco ONS 15530 Supported Hardware and Minimum Software Requirements (continued)

Component	Part Number	Description	Minimum Software Version Required
AC cables	15530-CAB-AC=	ONS 15530 ETSI AC cable, North America (spare)	12.1(10)EV4
	15530-CAB-ACA=	ONS 15530 ETSI AC cable, Australia (spare)	12.1(10)EV4
	15530-CAB-ACE=	ONS 15530 ETSI AC cable, Europe (spare)	12.1(10)EV4
	15530-CAB-ACU=	ONS 15530 ETSI AC cable, UK (spare)	12.1(10)EV4
	15530-CAB-ACI=	ONS 15530 ETSI AC cable, Italy (spare)	12.1(10)EV4
	15530-CAB-ACR=	ONS 15530 ETSI AC cable, Argentina (spare)	12.1(10)EV4
Blank panel cover	15530-COV-MUX=	OADM blank panel cover	12.1(10)EV4
	15530-COV-SLOT=	Full slot panel cover	12.1(10)EV4
	15530-COV-PWR=	Power supply blank panel cover	12.1(10)EV4
	15530-COV-OSC=	OSC blank panel cover	12.1(10)EV4
Fan assembly	15530-FT01=	Fan assembly (spare)	12.1(10)EV4
Air ramp baffle	15530-BAF-E=	Air baffle (spare) for 15530-CHAS-E chassis	12.1(10)EV4
CompactFlash card	15530-MEM=	CompactFlash card 32 MB	12.1(10)EV4
Accessory kit	15530-ACCKIT23	Accessory kit for 23 inch rack	12.1(10)EV4
	15530-ACCKIT19	Accessory kit for 19 inch rack	12.1(10)EV4
Rack mount kit	15530-RKMT-E=	Chassis rack mount kit for 15530-CHAS-E	12.1(10)EV4
	15530-RKMT-N23=	Chassis rack mount kit for 15530-CHAS-N (23 inch rack)	12.1(10)EV4
	15530-RKMT-N19=	Chassis rack mount kit for 15530-CHAS-N (19 inch rack)	12.1(10)EV4

Determining the Software Version



Note We strongly recommend that you use the latest available software release for all Cisco ONS 15530 hardware.

To determine the version of Cisco IOS software currently running on a Cisco ONS 15530 system, log in to the system and enter the **show version EXEC** command. The following sample output is from the **show version** command. The software version number is shown on the second line of the sample output.

```
Switch# show version
Cisco Internetwork Operating System Software
IOS (tm) ONS-15530 Software (ONS15530-I-M), Version 12.1(10)EV4
<Information deleted>
```

Upgrading the System Image

To ensure proper system functioning, follow the system image upgrading procedure described in the *Cisco ONS 15530 Software Upgrade Guide*.



Note Always set the configuration register to 0x2102 when upgrading the system image using the **config-reg 0x2102** command in configuration mode.



Caution Improper system image upgrades can affect system functioning and redundancy. Always follow the recommended upgrade procedures.

Feature Set Table

The Cisco IOS Release software is packaged in feature sets (also called software images) depending on the platform. Each feature set contains a specific set of Cisco IOS features. [Table 2](#) lists the Cisco IOS software feature sets available for the Cisco ONS 15530.

Table 2 *Feature Sets Supported by the Cisco ONS 15530*

Feature Set	12.1(12c)EV	12.1(10)EV4	12.1(10)EV4
Inband message channel	X	X	X
Gigabit Ethernet	X	X	X
Fast Ethernet	X	X	X
Ethernet	X	X	X
ATM OC-3/STM-1, OC-12/STM-4, and OC-48/STM-16	X	X	X
SONET ¹ /SDH ²	X	X	X
POS ³	X	X	X
IBM Sysplex coupling link	X	X	X

Table 2 *Feature Sets Supported by the Cisco ONS 15530*

Feature Set	12.1(12c)EV	12.1(10)EV4	12.1(10)EV4
Fibre Channel (1 Gbps)	X	X	X
Fibre Channel (2 Gbps)	X	X	X
FDDI ⁴	X	X	X
ESCON ⁵ aggregation (2.5 Gbps)	X	X	X
FICON ⁶ (800 Mbps)	X	X	X
Token ring	X	X	X
SNMP	X	X	X
CiscoView	X	X	X
Cisco Transport Manager	X	X	X
IP packets	X	X	X
OSCP ⁷	X	X	X
APS ⁸ channel protocol	X	X	X
Point-to-point	X	X	X
Hubbed ring	X	X	X
Meshed ring	X	X	X
IBM Sysplex ETR/CLO	X	X	X

1. SONET = Synchronous Optical Networking
2. SDH = Synchronous Digital Hierarchy
3. POS = Packet over SONET
4. FDDI = Fiber Distributed Data Interface
5. ESCON = Enterprise Systems Connection
6. FICON = Fiber Connection
7. OSCP = Optical Supervisory Channel Protocol
8. APS = Automatic Protection Switching

New and Changed Information

This section lists new features that appear in this and previous releases of Cisco IOS Release 12.1. The new features are sorted by release number.

New Features in Release 12.1(12c)EV

The following new hardware features are available for the Cisco ONS 15530 in Cisco IOS Release 12.1(12c)EV:

- The Cisco ONS 15530 8-port Fibre Channel/Gigabit Ethernet Multiplexing line card is an aggregation card capable of multiplexing up to 8 Fibre Channel / FICON / Gigabit Ethernet signals onto a single 10 Gbps ITU trunk card, or groups of 2 ports (e.g., ports 0 and 1) onto a 2.5 Gbps ITU trunk card, 10 Gbps ITU trunk card, or 10 Gbps uplink for connectivity to another ONS 15530 or to an ONS 15540 ESPx. Pluggable transceiver modules are required for operation and up to eight are supported.

- The Cisco ONS 15530 8-port Fibre Channel/Gigabit Ethernet Multiplexing line card supports the following pluggable transceiver modules:
 - Gigabit Ethernet/Fibre Channel - 1310nm SM - MTLC
 - Gigabit Ethernet/Fibre Channel - 850nm MM - 1G MTLC
- The Cisco ONS 15530 2.5 Gbps ITU trunk card is designed to be used with the 10-port ESCON and 8-port Fibre Channel/Gigabit Ethernet multiplexing cards to support up to 10-ports of ESCON or 2-ports of Fibre Channel/FICON/Gigabit Ethernet over a 2.5 Gbps ITU wavelength. The 2.5G ITU trunk card can be used in point-to-point and ring configurations.
- The Cisco ONS 15500 Protection Switch Module (PSM) allows a customer to protect the entire fiber path by splitting an optical signal from one fiber trunk into two redundant fiber paths. This offers customers a more cost effective protection option and achieve protection against fiber cuts in the network.

The following new software features are available for the Cisco ONS 15530 in Cisco IOS Release 12.1(12c)EV:

- Software capability allowing the Cisco ONS 15530 8-port Fibre Channel/Gigabit Ethernet Multiplexing Line Card to interwork with the 2.5 Gbps ITU trunk card, 10 Gbps ITU trunk card, or the 10 Gbps uplink. All 8-ports of the Fibre Channel/Gigabit Ethernet Multiplexing Line Card can be sent over a single 10 Gbps ITU trunk/uplink or groups of 2-ports can be sent to a 2.5 Gbps ITU trunk card or a 10 Gbps ITU trunk/uplink.
- The Cisco ONS 15530 supports per-channel unidirectional and bidirectional 1+1 path switching over both point-to-point and optical ring topologies for the 2.5 Gbps ITU Trunk Card. 1+1 protection, which is similar to SONET/SDH Automatic Path Switching (APS), is a method of protection in which one optical signal drives two sets of trunk fibers. One signal is used as the active fiber pair, and the other is used as the standby fiber pair should the working path be cut. When an active signal that is protected fails or in some cases degrades, the system automatically switches from the active network path to the standby network path.
- The Cisco ONS 15530 2.5 Gbps ITU trunk card supports a per-wavelength management channel providing OAM&P capabilities similar to SONET/SDH in the metro DWDM network. The per-wavelength management channel provides the robustness and quality of service (QoS) required for a carrier-class optical network. The management channel provides optical performance monitoring with alarm indication, along with failure isolation and protection mechanisms.
- A protection switching mechanism in software allowing the Cisco ONS 15500 with Protection Switch Modules to protect against a fiber failure on a trunk interface. Hardware and software is used to offer a 1+1 protection mechanism that is similar to the SONET Automatic Protection Switching (APS) standard. When a loss of light or a configurable level of signal degradation is detected, the software will switch from the working fiber path to the protection fiber path in less than 50ms.
- Simple Network Management Protocol (SNMP) support for the ONS 15530 line cards (8-port Fibre Channel/Gigabit Ethernet Multiplexing Line Card, 2.5 Gbps ITU Trunk Card, and Protection Switch Module) and for the ONS 15540 ESPx Protection Switch Module.
- The Cisco ONS 15530 supports power-on diagnostics that:
 - Power-on diagnostics tests the accessibility and basic functionality of the components present at the time of system bootup.
 - Isolates the faults to FRU level.
 - User can selectively disable/enable the Power-on diagnostics tests through CLI.
 - User can view the Power-on diagnostics results at a later time through CLI.

New Features in Release 12.1(10)EV4

No new features are available for the Cisco ONS 15530 in Cisco IOS Release 12.1(10)EV4.

Caveats

This section lists the caveats for the 12.1(12c)EV release. Use [Table 3](#) to determine the status of a particular caveat. In the table, “C” indicates a corrected caveat, and “O” indicates an open caveat.

Table 3 Caveat Matrix for the Cisco ONS 15530

DDTS Number	12.1(12c)EV	12.1(10)EV4	12.1(10)EV2
CSCdw35704	C	C	
CSCdx02980	C	C	
CSCdx78717	C	O	O
CSCdx83919	C	O	O
CSCdy01768	C	C	C
CSCdy02850	C	C	
CSCdy08228	C	C	
CSCdy20002	C	C	
CSCdy20010	C	C	
CSCdy20022	C	C	
CSCdy40864	C	C	
CSCdy40882	C	C	
CSCdy46550	C	O	O
CSCdy49249	C	C	
CSCdy53288	C	C	
CSCdy59551	C	O	O
CSCdy61641	C	C	
CSCdy63359	C	C	
CSCdy65411	C	C	
CSCdy66507	C	C	O
CSCdy68224	C	C	
CSCdy68257	C	C	
CSCdy68663	C		
CSCdy69086	C	C	O
CSCdy72463	C	C	C
CSCdy78546	C	C	
CSCdy81501	C	C	
CSCdy82663	C	C	

Table 3 *Caveat Matrix for the Cisco ONS 15530 (continued)*

DDTS Number	12.1(12c)EV	12.1(10)EV4	12.1(10)EV2
CSCdy85125	C	C	
CSCdy85563	C	C	
CSCdy88154	C	C	
CSCdz00116	C	C	
CSCdz02638	C		
CSCdz04036	C	C	
CSCdz06004	C	C	
CSCdz06602	C	C	
CSCdz08641	C	O	
CSCdz08774	C	C	
CSCdz11505	C	C	
CSCdz12139	C	C	
CSCdz12200	C	O	
CSCdz13538	C	C	
CSCdz13673	C	C	
CSCdz15649	C	O	
CSCdz16457	C	C	
CSCdz16522	C		
CSCdz20508	C	C	
CSCdz28582	C	C	
CSCdz33672	C	C	
CSCdz33752	C	C	
CSCdz34105	C	C	
CSCdz34254	C	C	
CSCdz36187	C	C	
CSCdz36234	C	O	
CSCdz36420	C	C	
CSCdz36823	C	C	
CSCdz38508	C	C	
CSCdz39711	C	C	
CSCdz40904	C	C	
CSCdz42349	C	O	
CSCdz43222	C		
CSCdz43372	C	C	
CSCdz43833	C	C	
CSCdz44366	C	O	

Table 3 Caveat Matrix for the Cisco ONS 15530 (continued)

DDTS Number	12.1(12c)EV	12.1(10)EV4	12.1(10)EV2
CSCdz44515	C	C	
CSCdz49152	C		
CSCdz52675	C		
CSCdz58566	C		
CSCdz59146	O		
CSCdz62296	O		
CSCdz62922	C		
CSCdz64021	O		
CSCdz66093	O		
CSCdz66609	O		
CSCdz67967	C		
CSCdz69573	C		
CSCdz69676	C		
CSCdz74084	C		
CSCdz75536	C		
CSCdz75949	O		
CSCdz76545	O		
CSCdz76637	C		
CSCdz76792	C		
CSCdz76891	O		
CSCdz76991	C		
CSCdz77094	O		
CSCdz79697	O		
CSCdz79922	O		
CSCdz81953	O		
CSCdz85221	O		
CSCdz86904	O		
CSCdz89270	O		

This section describes the caveats in the Cisco ONS 15530.

- [CSCdw35704](#)

Symptom: Unchecked buffer boundary in NTP.

Workaround: None.

- [CSCdx02980](#)

Symptom: When the NME is connected to an auto-sensing switch/hub, going from 10 Mbps/half to 100 Mbps/half (or similarly 10 Mbps/full to 100 Mbps/full) on FastEthernet0 results in the link going down.

Workaround: Configure FastEthernet0 as duplex auto and speed auto.

- [CSCdx78717](#)

Symptom: A change in optical threshold condition at a WB-VOA or PB-OE module power monitor may not be detected if the condition is temporary and does not last for more than a second.

Workaround: None

- [CSCdx83919](#)

Symptom: When swapping the ESCON line card with the 10-G ITU trunk line card in a given slot, the following error message is seen four times:

%BPE-3-NOT_REGISTERED: Interface[EthernetDcc9/0/0] MAC is not registered.

Workaround: None.

- [CSCdy01768](#)

Symptom: The CPU LED for alarms is not cleared even though the Optical Power Monitoring alarm gets cleared. There is no functionality problem. On a CPU switchover this alarm LED is cleared and gives the correct alarm status.

Workaround: OIR the card on which the alarm was generated.

- [CSCdy02850](#)

Symptom: When both wavepatches are in an administrative down state, a low alarm does not appear on the standby wavepatch after a **no shutdown** is done on the wave interface.

Workaround: Do a **shutdown** and a **no shutdown** command sequence on the interface; the low alarm is then reported for this interface.

- [CSCdy08228](#)
Symptom: Interface reports up/up even when there is no light source connected.
Workaround: Perform a shut and then a no shut on the interface.
- [CSCdy20002](#)
Symptom: A transparent interface carrying Gigabit Ethernet traffic and configured with gigabit Fibre Channel encapsulation shows good quality signal on the **show interfaces transparent** command output and does not assert any ingress alarms. The wave interface assert loss of lock and loss of sync alarms.
Workaround: Remove and reinsert the transponder module to bring it to the correct state.
- [CSCdy20010](#)
Symptom: LoF (loss of frame) alarms are not reasserted after a **shutdown/no shutdown** command sequence on both the transparent and wave interfaces on the transponder module.
Workaround: Disable and reenable monitoring on the transparent interface to reassert the alarms.
- [CSCdy20022](#)
Symptom: The **show facility-alarm** command status does not report existing LoF/LoSync/LoLock alarms after OIR/hw-mod power off/on.
Workaround: Disable and enable monitoring back will reassert existing alarms in the show facility-alarm status.
- [CSCdy40864](#)
Symptom: A software compatibility problem causes the active CPU to reset the standby CPU.
Workaround: None.
- [CSCdy40882](#)
Symptom: The **show hardware** command output displays information about the CPU that has been removed from the system.
Workaround: None.
- [CSCdy46550](#)
Symptom: OSC wave and ethernetdcc interfaces come up with default traffic-shaping parameters. Since this is considered as default, on removing the configuration using the **no** form of the command, the parameter value should revert back to the default value, which is not being done.
Workaround: Reconfigure the traffic-shaping parameters.
- [CSCdy49249](#)
Symptom: If a line card that was removed prior to switchover is inserted during switchover, the line card may not come up properly.
Workaround: Insert the line card after switchover is complete.
- [CSCdy53288](#)
Symptom: The system crashes at is_optical_ifstatus_up.
Workaround: None.

- [CSCdy59551](#)

Symptom: Performing a **shutdown command** on the active wavepatch of a nonsplitter card brings the waveethernetphy interface down and reports "Loss of Light" in the output of the **show interface** command, but the traffic continues to flow.

Workaround: If the intent is to stop traffic, do a **shutdown** on the waveethernetphy interface.
- [CSCdy61641](#)

Symptom: Following a CPU crash and switchover, the **show redundancy** command shows "Not known", without any additional information.

Workaround: Enter **show version** from the standby CPU console to see the additional information.
- [CSCdy63359](#)

Symptom: The **getnext** and **getbulk** commands do not function properly after a CPU switchover.

Workaround: None.
- [CSCdy65411](#)

Symptom: APS traps mode mismatch takes 30 minutes for completion.

Workaround: None.
- [CSCdy66507](#)

Symptom: Low alarm is not cleared on the wavepatch interface for the transponder.

Workaround: Perform a **shutdown/no shutdown** command sequence on the wavepatch where it is seen.
- [CSCdy68224](#)

Symptom: CVRD, CRC or CDL HEC error counters are not incremented, but the CDL HEC SF condition is exceeded.

Workaround: None.
- [CSCdy68257](#)

Symptom: When trying to modify cApsConfigSpan through SNMP set to an unsupported value, no error is reported.

Workaround: None.
- [CSCdy68663](#)

Symptom: Administrative shutdown on a WaveEthernetPhy sub-interface does not take affect. It shows up in the display as "admin shut" but all the traffic flows through and the sub-interface is fully functional.

Workaround: None.
- [CSCdy69086](#)

Symptom: Alarms are created on the wave interface by pulling out the cable.

Workaround: The **shutdown** command will clear all of the alarms on the wave interface.
- [CSCdy72463](#)

Symptom: Spurious memory access is seen when issuing the **show tech** command on the standby CPU; the **show align** command shows an increase in the spurious memory errors after each **show tech** command is issued.

Workaround: None

- [CSCdy78546](#)
Symptom: PTOPO configuration rows can be configured for nonexistent interfaces.
Workaround: None.
- [CSCdy81501](#)
Symptom: The **show connect intermediate** command output does not display all the protection paths when a switch fabric cross connect is used.
Workaround: Display the information using the **show connect** command.
- [CSCdy82663](#)
Symptom: Active CPU incorrectly detects a faulty switch fabric port, causing a switchover to the standby CPU.
Workaround: None.
- [CSCdy85125](#)
Symptom: When copying or reading a file to or from Compact flash (disk0), a transient error with the following message may appear and read/write access to compact flash is terminated:

```
ATA_Status timeout waiting for <1/2/3>
```

Workaround: None.
- [CSCdy85563](#)
Symptom: Defect-indication error message does not give information if the defect-indication bit was cleared or asserted for that interface.
Workaround: None.
- [CSCdy88154](#)
Symptom: Some interfaces are not be available to the NMS station since the agent does not create them on OIR.
Workaround: Reload the box after removal/insertion of the cards.
- [CSCdz00116](#)
Symptom: APS message channel configured for UDP/IP does not work over two IP hops. The UDP/IP packets get dropped at the end of the second hop.
Workaround: None.
- [CSCdz02638](#)
Symptom: Loopback interfaces cannot be deleted from configuration.
Workaround: None.
- [CSCdz04036](#)
Symptom: Switch fabric protection is not disabled if the nonactive CPU is in rommon. As a result if an RxFail is noticed on any fabric port, that fabric port will switch over its receive to the nonactive CPU.
Workaround: None.
- [CSCdz06004](#)
Symptom: The **redundancy reload shelf** command on the Active CPU can cause a switchover if the peer CPU is in rommon.
Workaround: Use the **reload** command to reload the Active CPU, if the peer CPU is in rommon.

- [CSCdz06602](#)
Symptom: Issuing **getbulk** command to retrieve PM parameters returns 0 row.
Workaround: None.
- [CSCdz08641](#)
Symptom: The `ciscoFlashPartitionFileCount` returns an incorrect number of files on the flash card.
Workaround: None.
- [CSCdz08774](#)
Symptom: `ciscoFlashDeviceChangeTrap` should be supported on ONS155xx platforms since it is a basic operation. Whenever a removable flash device is removed or inserted, this trap should be generated.
Workaround: None.
- [CSCdz11505](#)
Symptom: When FLC (forward laser control) is disabled on all 10 esconphy ports and they are administratively shut down, packets are still being sent to the backplane.
Workaround: None.
- [CSCdz12139](#)
Symptom: OPM feature does not work for nonsplitter transponders.
Workaround: None.
- [CSCdz12200](#)
Symptom: Invalid mac-address or ip-address can be made via SNMP. No error check is done.
Workaround: Delete the entry through SNMP or with the **topology neighbor disable** command.
- [CSCdz13538](#)
Symptom: Egress Loss of Signal alarm is not reasserted in the **show facility alarm status** output after the hardware module power is turned off and turned back on.
Workaround: None.
- [CSCdz13673](#)
Symptom: The wave interface remains down when the signal quality is GOOD, after the hardware module power is turned off and turned back on.
Workaround: None.
- [CSCdz15649](#)
Symptom: When wave interface is in SHUT mode, the corresponding active wavepatch interface is brought down and a low alarm is asserted.
Workaround: None.
- [CSCdz16457](#)
Symptom: When IOS is rebooted on a system and a transient link failure condition occurs on 10 G DWDM Uplink cards, system may continuously send the backward defect indication.
Workaround: None.

- [CSCdz16522](#)

Symptom: Error messages appear when the 10-GE line card cross-connect to the switch fabric is removed.

Workaround: None.
- [CSCdz20508](#)

Symptom: The wavepathe interfaces are stuck in the down state after using the **show wave interface** command with splitter APS after the trunk fiber has been cut.

Workaround: None.
- [CSCdz28582](#)

Symptom: After a fiber cut, the OSC interface remains up with signal quality good.

Workaround: Use the **shut/no shut** command.
- [CSCdz33672](#)

Symptom: The standby CPU can get stuck in trying to register control ports.

Workaround: Enter **redundancy reload peer** on the active CPU.
- [CSCdz33752](#)

Symptom: In bidirectional APS, if both NEs have the same priority request, the master/slave determination fails, leading to both claiming the control and resulting in not sending a REVERSE-REQUEST.

Workaround: None.
- [CSCdz34105](#)

Symptom: When a **shutdown/noshutdown** command sequence is done on a waveethernetphy interface that is in the UP state, the Signal Condition shows Loss of Lock.

Workaround: None.
- [CSCdz34254](#)

Symptom: In bidirectional line card protection, if the APS group is associated with working cross connect invalid and protection cross connect 'active', APS erroneously sets the aps channel request on working to WAIT-TO-RESTORE. This does not recover even when the working cross connect is made dormant by the connection manager. As a result both NEs are pegged to protection until an event (that has higher priority than WTR) is triggered.

Workaround: None.
- [CSCdz36187](#)

Symptom: Splitter APS protection comes up as active on bootup.

Workaround: None.
- [CSCdz36234](#)

Symptom: Dynamic discovery of topology via CDP on the tengigethernetphy interface is not configurable.

Workaround: None.
- [CSCdz36420](#)

Symptom: In a preconfigured APS group (for the case when the interfaces do not exist), if the group is configured for revertive mode, it cannot be enabled.

Workaround: None.

- [CSCdz36823](#)
Symptom: The CPU crashes after midnight with optical performance monitoring on when an interface capable of performance monitoring is shut down before 00-00hrs and unshut after midnight.
Workaround: None.
- [CSCdz38508](#)
Symptom: In unidirectional revertive APS, after OIR removal is followed by OIR insertion of working and protection elements on both NEs, the active signal may be received from the protection line instead of the working line.
Workaround: Do a manual or force switch to working line.
- [CSCdz39711](#)
Symptom: SEF errors are repeatedly asserted on the console and are not soaked.
Workaround: None.
- [CSCdz40904](#)
Symptom: When an interface is shut down administratively, the **show aps detail** command shows the channel request as sf-lp; however, a get on the object **cApsChanStatusCurrent** does not reflect sf-lp in the corresponding bits.
Workaround: None.
- [CSCdz42349](#)
Symptom: Connection to a different subinterface on the same 10-G card is accepted, but crossconnection fails in the switch fabric.
Workaround: None.
- [CSCdz43222](#)
Symptom: The MTU setting on the 10-GE line card interface is not displayed in the **show interface** command output. Transmit side is reporting oversize frames.
Workaround: None.
- [CSCdz43372](#)
Symptom: APS group is displayed as "not associated" in **show aps detail** command output.
Workaround: Do a **shutdown/no shutdown** command sequence to either or both interfaces in the APS group. This causes a state change of the interfaces. You can also do a **disable/enable** to the APS group.
- [CSCdz43833](#)
Symptom: Y-cable transponder protection does not come up as active after removing lockout.
Workaround: Do a **disable/enable** to the APS group.
- [CSCdz44366](#)
Symptom: With linecard protection configured, the switch fabric on both the active CPU and the standby CPU are out of sync.
Workaround: Insert all the cards and perform a **no connect** command and then **connect** command.

- [CSCdz44515](#)

Symptom: CDR loss of lock is not reported after Sysplex CLO/ETR encapsulation on a transparent interface.

Workaround: Perform a **shutdown/no shutdown** command sequence on the interface to correct the CDR loss of lock reporting.
- [CSCdz49152](#)

Symptom: Tx CRC and CDL-HEC error counters do not show the proper values in the **show interface** command output for the 10-GE interface.

Workaround: None.
- [CSCdz52675](#)

Symptom: Wave interfaces see a continuous flap when shutting the wavepatch on a non-splitter card.

Workaround: None.
- [CSCdz58566](#)

Symptom: Wavepatch configurations are retained when swapping a 10-GE, 2.5-Gbps ITU trunk, or transponder card.

Workaround: Find out the card type and reuse the wavepatch id by cleaning up the config.
- [CSCdz59146](#)

Symptom: Loss of connectivity via the ethernetccc interface occurs when splitter protection is configured and the waveethernetphy interface is shut down while protection on the wavepatch is active and the working wavepatch is down.

Workaround: Do not shut down the waveethernetphy interface while the working wavepatch is down.
- [CSCdz62296](#)

Symptom: PSM is incorrectly recognized as mux/demux card with IOS images that do not have support for the PSM.

Workaround: Upgrade software to 12.1(12c)EV.
- [CSCdz62922](#)

Symptom: When lockout on working is removed with a signal failure on working, the splitter switches back and forth between protection and working on 2.5-Gbps and 10-Gbps splitter protected cards.

Workaround: None.

- [CSCdz64021](#)

Symptom: While performing an OIR of a protection card in a y-cable configuration, the local and remote working port is flooded with CRC errors.

Workaround: Disconnect the standby branch of the y-cable during standby line card or SFP insertion.
- [CSCdz66093](#)

Symptom: 10-Gbps ITU trunk line cards fail during power-on diagnostics at Quadphy loopback test (**qphy-fabric-lb**).

Workaround: None.
- [CSCdz66609](#)

Symptom: Traffic loss of 30-45 sec might occur when a y-cable APS configuration with protection switchover is used with the Catalyst 6000 family.

Workaround: Disable auto-negotiation and enable debounce timer with 100-ms delay on Catalyst 6000 family using the **set port debounce mod/port enable** command sequence.
- [CSCdz67967](#)

Symptom: Update alarms and add new alarms for new cards.

Workaround: None.
- [CSCdz69573](#)

Symptom: Controller type for the backplane is not displayed in the **show hardware detail** command output.

Workaround: None.
- [CSCdz69676](#)

Symptom: The **show optical filter** command output shows invalid information regarding the interface wavelength for filters.

Workaround: None.
- [CSCdz74084](#)

Symptom: The system crashes when WB-VOA and WB-PE modules are removed.

Workaround: None.
- [CSCdz75536](#)

Symptom: Transmit failure is cleared before APS is notified of failure and does not take correct action.

Workaround: Shut and unshut the interface.
- [CSCdz75949](#)

Symptom: Disconnecting a 10-port ESCON or 8-port FC/GE aggregation card from a 2.5-Gbps ITU trunk card can cause two ports to have the same CDL flow identifier.

Workaround: Avoid assigning same CDL flow identifier to the ports in the portgroup.
- [CSCdz76545](#)

Symptom: The gt-interrupt and interrupt0 tests on the CPU fail.

Workaround: None.

- [CSCdz76637](#)
Symptom: Because of the inability to synchronize the standby CPU switch module (with latest IOS image) has lower capabilities than the active processor (older EV4 image). The following alarm appears:
%CPU_REDUN-3-CAPABILITIES: Alarm: ASSERT, MINOR, PSC card 5, Standby with lower capabilities.
Workaround: None.
- [CSCdz76792](#)
Symptom: The WB-VOA functional image version is different in the **show hardware** and **show controllers** command output.
Workaround: None.
- [CSCdz76891](#)
Symptom: On a splitter APS switchover based on a CVRD SF condition, the SF threshold exceeded count is not incremented. There is also no log or event on the console that differentiates between switches overdue to CVRD SF or loss-of-lock.
Workaround: None.
- [CSCdz76991](#)
Symptom: High alarm and low alarm status not cleared for WB-VOA or PB-OE modules when optical power is in a high warning or low warning state.
Workaround: None.
- [CSCdz77094](#)
Symptom: Card access failure is seen when a new line card is inserted, but no alarm is reported to the network management station.
Workaround: None.
- [CSCdz79697](#)
Symptom: Removing the configured threshold for CDL and CRC removes the template (and default values) resulting in CDL and CRC errors.
Workaround: Apply a threshold group for CRC/CDL-HEC from CLI and remove it.
- [CSCdz79922](#)
Symptom: When removing a 2.5-Gpbs ITU Trunk card from the shelf, the following error message may appear:
%LC_2P5G-3-INTERNAL_CRITICAL: physubcard/idprom NULL in city_island_get_laser_frequency
Workaround: None.
- [CSCdz81953](#)
Symptom: When WaveEthernetPhy interface on a 2.5-Gbps ITU trunk card with splitter APS configured, loss-of-lock and loss-of-lync alarms are reported in the output of the **show facility-alarm status** command.
Workaround: None.

- [CSCdz85221](#)

Symptom: When ESCON data traffic is mixed with Gigabit Ethernet traffic cross connected to same 10-Gbps ITU trunk cards, the ESCON traffic will experience errors. Ports on ESCON Director might not even come up.

Workaround: Assign all 10 ports on ESCON aggregation card with valid flow identifiers.

- [CSCdz86904](#)

Symptom: The **tx-buffer size** command on the portgroup interface on the ESCON aggregation card. This command has to be moved to the esconphy interfaces.

Workaround: Configure the command from the portgroup interface.

on the ESCON card.

- [CSCdz89270](#)

Symptom: OFC (Open Fiber Control) is not supported with Fibre Channel on the 8-port FC/GE aggregation card. The link may not initialize if an 8-port FC/GE aggregation card is used with older Fibre Channel equipment which employ OFC laser safety mechanisms.

Workaround: None.

Limitations and Restrictions

This section provides limitations and restrictions for Cisco ONS 15530 hardware and software.

Transponder Modules

This section contains limitations and restrictions that apply to transponder modules.

- CRC errors may occur with 2-Gbps Fibre Channel on single-mode transponders when high input power levels are received from the client laser sources.

Data errors or link-down conditions for 2-Gbps Fibre Channel might occur when used with certain client laser sources. Transmitters in some client GBIC and SFP transceiver units might send large overshoots in optical power with signal bit transitions, causing momentary overload conditions on the transponder client side receiver. The average transmitted power level from the GBIC does not violate the overload specification of the transponder client side receiver, so a power meter does not detect the overload.

The workaround is to attenuate the signal from the client equipment to a recommended level of -12 dBm when transmitting 2-Gbps Fibre Channel services.

CPU Switch Modules

This section contains limitations and restrictions that apply to transponder modules.

- If both CPU switch modules are removed, all aggregation cards, OSC modules, transponder line cards, ITU trunk cards, and uplink cards are shut down.



Note

Traffic on pass through optical channels (which passively pass through the OADM modules) are not affected by the removal of the processor cards.

Related Documentation

Refer to the following documents for more information about the Cisco ONS 15530:

- [Regulatory Compliance and Safety Information for the Cisco ONS 15500 Series](#)
- [Cisco ONS 15530 Planning Guide](#)
- [Cisco ONS 15530 Hardware Installation Guide](#)
- [Cisco ONS 15530 Optical Transport Turn-Up and Test Guide](#)
- [Cisco ONS 15530 Cleaning Procedures for Fiber Optic Connections](#)
- [Cisco ONS 15530 Configuration Guide](#)
- [Cisco ONS 15530 Command Reference](#)
- [Cisco ONS 15530 System Alarms and Error Messages](#)
- [Cisco ONS 15530 Troubleshooting Guide](#)
- [Network Management for the Cisco ONS 15530](#)
- [Cisco ONS 15530 TLI Commands](#)
- [MIB Quick Reference for the Cisco ONS 15500 Series](#)
- [Cisco ONS 15530 Software Upgrade Guide](#)

Obtaining Documentation

Cisco provides several ways to obtain documentation, technical assistance, and other technical resources. These sections explain how to obtain technical information from Cisco Systems.

Cisco.com

You can access the most current Cisco documentation on the World Wide Web at this URL:

<http://www.cisco.com/univercd/home/home.htm>

You can access the Cisco website at this URL:

<http://www.cisco.com>

International Cisco web sites can be accessed from this URL:

http://www.cisco.com/public/countries_languages.shtml

Documentation CD-ROM

Cisco documentation and additional literature are available in a Cisco Documentation CD-ROM package, which may have shipped with your product. The Documentation CD-ROM is updated monthly and may be more current than printed documentation. The CD-ROM package is available as a single unit or through an annual subscription.

Registered Cisco.com users can order the Documentation CD-ROM (product number DOC-CONDOCCD=) through the online Subscription Store:

<http://www.cisco.com/go/subscription>

Ordering Documentation

You can find instructions for ordering documentation at this URL:

http://www.cisco.com/univercd/cc/td/doc/es_inpck/pdi.htm

You can order Cisco documentation in these ways:

- Registered Cisco.com users (Cisco direct customers) can order Cisco product documentation from the Networking Products MarketPlace:
<http://www.cisco.com/en/US/partner/ordering/index.shtml>
- Registered Cisco.com users can order the Documentation CD-ROM (Customer Order Number DOC-CONDOCCD=) through the online Subscription Store:
<http://www.cisco.com/go/subscription>
- Nonregistered Cisco.com users can order documentation through a local account representative by calling Cisco Systems Corporate Headquarters (California, U.S.A.) at 408 526-7208 or, elsewhere in North America, by calling 800 553-NETS (6387).

Documentation Feedback

You can submit comments electronically on Cisco.com. On the Cisco Documentation home page, click **Feedback** at the top of the page.

You can e-mail your comments to bug-doc@cisco.com.

You can submit your comments by mail by using the response card behind the front cover of your document or by writing to the following address:

Cisco Systems
Attn: Customer Document Ordering
170 West Tasman Drive
San Jose, CA 95134-9883

We appreciate your comments.

Obtaining Technical Assistance

Cisco provides Cisco.com, which includes the Cisco Technical Assistance Center (TAC) Website, as a starting point for all technical assistance. Customers and partners can obtain online documentation, troubleshooting tips, and sample configurations from the Cisco TAC website. Cisco.com registered users have complete access to the technical support resources on the Cisco TAC website, including TAC tools and utilities.

Cisco.com

Cisco.com offers a suite of interactive, networked services that let you access Cisco information, networking solutions, services, programs, and resources at any time, from anywhere in the world.

Cisco.com provides a broad range of features and services to help you with these tasks:

- Streamline business processes and improve productivity
- Resolve technical issues with online support

- Download and test software packages
- Order Cisco learning materials and merchandise
- Register for online skill assessment, training, and certification programs

To obtain customized information and service, you can self-register on Cisco.com at this URL:

<http://www.cisco.com>

Technical Assistance Center

The Cisco TAC is available to all customers who need technical assistance with a Cisco product, technology, or solution. Two levels of support are available: the Cisco TAC website and the Cisco TAC Escalation Center. The avenue of support that you choose depends on the priority of the problem and the conditions stated in service contracts, when applicable.

We categorize Cisco TAC inquiries according to urgency:

- Priority level 4 (P4)—You need information or assistance concerning Cisco product capabilities, product installation, or basic product configuration.
- Priority level 3 (P3)—Your network performance is degraded. Network functionality is noticeably impaired, but most business operations continue.
- Priority level 2 (P2)—Your production network is severely degraded, affecting significant aspects of business operations. No workaround is available.
- Priority level 1 (P1)—Your production network is down, and a critical impact to business operations will occur if service is not restored quickly. No workaround is available.

Cisco TAC Website

You can use the Cisco TAC website to resolve P3 and P4 issues yourself, saving both cost and time. The site provides around-the-clock access to online tools, knowledge bases, and software. To access the Cisco TAC website, go to this URL:

<http://www.cisco.com/tac>

All customers, partners, and resellers who have a valid Cisco service contract have complete access to the technical support resources on the Cisco TAC website. Some services on the Cisco TAC website require a Cisco.com login ID and password. If you have a valid service contract but do not have a login ID or password, go to this URL to register:

<http://tools.cisco.com/RPF/register/register.do>

If you are a Cisco.com registered user, and you cannot resolve your technical issues by using the Cisco TAC website, you can open a case online at this URL:

<http://www.cisco.com/en/US/support/index.html>

If you have Internet access, we recommend that you open P3 and P4 cases through the Cisco TAC website so that you can describe the situation in your own words and attach any necessary files.

Cisco TAC Escalation Center

The Cisco TAC Escalation Center addresses priority level 1 or priority level 2 issues. These classifications are assigned when severe network degradation significantly impacts business operations. When you contact the TAC Escalation Center with a P1 or P2 problem, a Cisco TAC engineer automatically opens a case.

To obtain a directory of toll-free Cisco TAC telephone numbers for your country, go to this URL:

<http://www.cisco.com/warp/public/687/Directory/DirTAC.shtml>

Before calling, please check with your network operations center to determine the level of Cisco support services to which your company is entitled: for example, SMARTnet, SMARTnet Onsite, or Network Supported Accounts (NSA). When you call the center, please have available your service agreement number and your product serial number.

Obtaining Additional Publications and Information

Information about Cisco products, technologies, and network solutions is available from various online and printed sources.

- The *Cisco Product Catalog* describes the networking products offered by Cisco Systems as well as ordering and customer support services. Access the *Cisco Product Catalog* at this URL:
http://www.cisco.com/en/US/products/products_catalog_links_launch.html
- Cisco Press publishes a wide range of networking publications. Cisco suggests these titles for new and experienced users: *Internetworking Terms and Acronyms Dictionary*, *Internetworking Technology Handbook*, *Internetworking Troubleshooting Guide*, and the *Internetworking Design Guide*. For current Cisco Press titles and other information, go to Cisco Press online at this URL:
<http://www.ciscopress.com>
- *Packet* magazine is the Cisco monthly periodical that provides industry professionals with the latest information about the field of networking. You can access *Packet* magazine at this URL:
http://www.cisco.com/en/US/about/ac123/ac114/about_cisco_packet_magazine.html
- *iQ Magazine* is the Cisco monthly periodical that provides business leaders and decision makers with the latest information about the networking industry. You can access *iQ Magazine* at this URL:
http://business.cisco.com/prod/tree.taf%3fasset_id=44699&public_view=true&kbns=1.html
- *Internet Protocol Journal* is a quarterly journal published by Cisco Systems for engineering professionals involved in the design, development, and operation of public and private internets and intranets. You can access the *Internet Protocol Journal* at this URL:
http://www.cisco.com/en/US/about/ac123/ac147/about_cisco_the_internet_protocol_journal.html
- Training—Cisco offers world-class networking training, with current offerings in network training listed at this URL:
http://www.cisco.com/en/US/learning/le31/learning_recommended_training_list.html

This document is to be used in conjunction with the documents listed in the “[Related Documentation](#)” section.

CCIP, CCSP, the Cisco Arrow logo, the Cisco *Powered* Network mark, Cisco Unity, Follow Me Browsing, FormShare, and StackWise are trademarks of Cisco Systems, Inc.; Changing the Way We Work, Live, Play, and Learn, and iQuick Study are service marks of Cisco Systems, Inc.; and Aironet, ASIST, BPX, Catalyst, CCDA, CCDP, CCIE, CCNA, CCNP, Cisco, the Cisco Certified Internetwork Expert logo, Cisco IOS, the Cisco IOS logo, Cisco Press, Cisco Systems, Cisco Systems Capital, the Cisco Systems logo, Empowering the Internet Generation, Enterprise/Solver, EtherChannel, EtherFast, EtherSwitch, Fast Step, GigaDrive, GigaStack, HomeLink, Internet Quotient, IOS, IP/TV, iQ Expertise, the iQ logo, iQ Net Readiness Scorecard, LightStream, Linksys, MeetingPlace, MGX, the Networkers logo, Networking Academy, Network Registrar, *Packet*, PIX, Post-Routing, Pre-Routing, ProConnect, RateMUX, Registrar, ScriptShare, SlideCast, SMARTnet, StrataView Plus, SwitchProbe, TeleRouter, The Fastest Way to Increase Your Internet Quotient, TransPath, and VCO are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the United States and certain other countries.

All other trademarks mentioned in this document or Website are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (0403R)

Copyright © 2003 Cisco Systems, Inc. All rights reserved.