

# Release Notes for Cisco Catalyst 4224 Access Gateway Switch for Cisco IOS Release 12.2(2)YC1



**Cisco IOS Release 12.2(2)YC1 was deferred by CSCdy01975.** For more information, see the "Important Notes" section on page 3.

October 24, 2002



You can find the most current Cisco IOS documentation on Cisco.com. This set of electronic documents may contain updates and modifications made after the hard-copy documents were printed.

These release notes for the Cisco Catalyst 4224 Access Gateway Switch describe the software features provided in Cisco IOS Release 12.2(2)YC1. These release notes are updated as needed.



MGCP is not supported, even though it appears in the documentation and the command-line interface (CLI).

## **Contents**

These release notes describe the following topics:

- Introduction, page 2
- System Requirements, page 2
- New and Changed Information, page 3
- Limitations and Restrictions, page 3
- Important Notes, page 3
- Bug Fixes in Cisco IOS Release 12.2(2)YC1, page 4



Corporate Headquarters: Cisco Systems, Inc., 170 West Tasman Drive, San Jose, CA 95134-1706 USA

- Caveats, page 6
- Related Documentation, page 8
- Obtaining Documentation, page 11
- Obtaining Technical Assistance, page 12

## Introduction

The Cisco Catalyst 4224 Access Gateway Switch is an Ethernet switching router that provides Voice over IP (VoIP) gateway and IP telephony services. It is designed to be part of a centralized Cisco CallManager application.

# **System Requirements**

This section describes the system requirements for Cisco IOS Release 12.2(2)YC1 and includes the following sections:

- Memory Requirements, page 2
- Hardware Supported, page 2
- Determining the Software Version, page 3

## **Memory Requirements**

Table 1 Minimum Memory Recommendations for the Cisco Catalyst 4224 Access Gateway Switch

Platforms	Image Name	Software Image	Flash Memory Recommended	DRAM Memory Recommended	Runs From
Cisco c4224	IP/FW PLUS IPSEC 56	c4224-ik8o3sx3-mz	32 MB Flash	64 MB DRAM	RAM
	IP PLUS IPSEC 56	c4224-ik8sx3-mz	32 MB Flash	64 MB DRAM	RAM
	IP/FW PLUS IPSEC 3DES	c4224-ik9o3sx3-mz	32 MB Flash	64 MB DRAM	RAM
	IP PLUS/3DES	c4224-ik9sx3-mz	32 MB Flash	64 MB DRAM	RAM
	IP/FW/ PLUS	c4224-io3sx3-mz	32 MB Flash	64 MB DRAM	RAM
	IP PLUS	c4224-isx3-mz	32 MB Flash	64 MB DRAM	RAM
	BOOT	c4224-cboot-mz	32 MB Flash	64 MB DRAM	RAM

#### **Hardware Supported**

· Cisco Catalyst 4224 Access Gateway Switch

#### **Determining the Software Version**

To determine the version of Cisco IOS software running on your Cisco Catalyst 4224 Access Gateway Switch, log in to the Cisco Catalyst 4224 Access Gateway Switch and enter the **show version** command in user EXEC mode:

Router> show version Cisco Internetwork Operating System Software IOS (tm) 12.1(5) Software (c4224-isx3-mz), Version 12.2(2)YC1, RELEASE SOFTWARE

# **New and Changed Information**

The following sections list the new hardware and software features in Cisco IOS Release 12.2(2)YC1.

## New Hardware Features in Cisco IOS Release 12.2(2)YC1

There are no new hardware features in this release.



The Catalyst 4224 does not support hardware flow control on the console port.

## New Software Features in Cisco IOS Release 12.2(2)YC1

802.1q trunking support

#### **Limitations and Restrictions**

The following MIBs are supported:

- SNMP MIB-II
- ENTITY-MIB
- IF-MIB
- BRIDGE-MIB

The following Cisco proprietary MIBs are supported:

- CISCO-PROCESS-MIB
- CISCO-MEMORY-POOL-MIB
- · CISCO-CDP-MIB

The following feature is not supported in Release 12.2(2)YC1:

• half-duplex mode for WIC-1T

## **Important Notes**

Cisco IOS Releases 12.2(2)YC and 12.2(2)YC1 were deferred due to caveat CSCdy01975. The software solution for these deferred images is Cisco IOS Release 12.2(2)YC3, which is available on Cisco.com.

To increase network availability, Cisco recommends that you upgrade affected Cisco IOS images with the suggested replacement software images. Cisco will discontinue manufacturing shipment of affected Cisco IOS images. Any pending order will be substituted by the replacement software images.



Please be aware that failure to upgrade the affected Cisco IOS images may result in network downtime.

The terms and conditions that governed your rights and obligations and those of Cisco, with respect to the deferred images will apply to the replacement images.

# Bug Fixes in Cisco IOS Release 12.2(2)YC1

The following reported bugs have been fixed or resolved in Cisco IOS Release 12.2(2)YC1:

CSCdw22242

Ignore ingress multicast traffic on dot1q trunk

CSCdx27294

Layer 2 stops forwarding Rx packets over time

CSCdx18216

Set default IO memory on Catalyst 4224 to 15 percent

CSCdx32396

Unable to disable SNMP trap link status on switchport

CSCin04284

Unable to discover the interfaces in VWIC cards using SNMP

CSCdx37852

ring frequency configuration lost after reload

CSCdu76794

The ISDN switch type should be the same in global and ep GUI

CSCdx12085

Dial-peer prefix displayed incorrectly after download

CSCdw46596

Default loss plan is not correct

CSCdw85548

DSP not allocated when data BRI is configured

• CSCdx41085

FXS fail to change impedance from Complex2 to 600R

CSCdw88033

Support for QDM in 4224

CSCdw92443

FPU exception crash after hold and no Cisco CallManager music.

CSCdx35875

Sh ip igmp group shows previous Multi IP even though there was no Cisco CallManager music

CSCdx38095

Tabla Enhancements

CSCdu82132

Router crashes with bus error at hdsprm htsp tsp map

CSCdw89127

CISCO-VLAN-MEMBERSHIP-MIB support for Catalyst 4224

CSCin03446

Fast Ethernet ports cannot be discovered using ENTITY-MIB

CSCdw11594

Music on Hold is not played to PSTN when "MTP required" is set and no software MTP is available

CSCdx35497

SNMP: implement new module type assignments for ENTITY-MIB in Catalyst 4224

CSCdu51646

IKE Delete/Notify messages can cause watchdog timeouts

• CSCdu57580

Memory leak in Crypto IKMP process

CSCdv16137

MC3810 crashes @ dsx1\_display\_cas\_tonetype

CSCdu82674

Loop in *crypto\_gen\_ipsec\_isakmp\_delete* is infinite due to FSM

CSCdx34547

No configuration-error history

• CSCdx32863

Traceback on configuration download and spurious memory access

CSCin08663

PI4/tromb/3620: endpt loses registration on adding port1 of T1CAS back

CSCdw05814

Voice class codec remains in configuration after changing to gateway mode

CSCdx28793

Suspend and resume dropped

CSCdx18298

Restart gateway (on Cisco CallManager) puts the MGCP down

CSCdx33500

Add new configuration for Echo cancellation

CSCin07430

PI4/tromb/3620:maximum dial-peer prefix needs to be defined

CSCdx19813

CANA assignment and update of revision clause

CSCdw49897

Change names of duplicate files in bcmxx

CSCdx25334

New DSP code for 12.2(2)YC1

CSCdx18513

No inbound or outbound calls working with R2 signal

#### **Caveats**



MGCP is not supported in this release even though it appears in the documentation and the CLI.

This section lists unresolved caveats that apply to this release of the Cisco Catalyst 4224 Access Gateway Switch. Caveats describe unexpected behavior or defects in the switch and its related software.

CSCdw11594

PSTN users will not hear Music on Hold (MoH) when a call is placed on hold by an IP phone that is in a G.711 region and the requirement for media termination point (MTP) is selected on the AGM.

Workaround: The device must have a Software MTP available in its Media Resource Group List.

CSCin04209

Description: When the Catalyst 4224 is queried for *cardIfCardIndex* SNMP mib object, it does not return correct values.

Workaround: None.

CSCin04412

Description: SNMP support is not available for the following LEDs on the chassis of Catalyst 4224:

- STATUS LED
- Switch Utilization LEDs
- PS LED
- RPS LED
- Link status LEDs

Workaround: None

CSCin04963

Description: SNMP query to cpmCPUTotalTable returns incorrect values.

Workaround: None

#### CSCin06538

Description: SNMP response for the variable card type returns *unknown* (1) when the following cards are inserted in the Catalyst 4224:

- + WIC-1T
- + WIC-2T
- + WIC-1DSU-T1

Without this variable, these cards cannot be found in Cisco View.

Workaround: None

CSCin06631

Description: IP address table rows cannot be created or modified using SNMP.

Workaround: None

CSCin06633

Description: The rows in *ipNetToMediaTable* cannot be created or modified using SNMP.

Workaround: None

CSCdt16110

Description: An analog voice port configured with *alaw* companding port may experience excessive noise. The port also may not recognize DTMF digits in this configuration. Calls can still be received but there will be noise.

Workaround: Use A-to-u law transcoding at the T1/E1 or VoIP port.

CSCdv29907

Description: Memory corruption in tplus\_encode\_ulong. Under unknown conditions, a Cisco router running 12.2(3.4)T or later, and using TACACS+ accounting, may reload due to memory corruption.

Workaround: Disable TACACS+ accounting.

CSCdv82735

Description: If IP phones and fast ethernet ports are hard coded for speed and/or duplex, phones will never power up.

Workaround: Set both IP phone and fast ethernet ports for AUTO negotiation.

CSCdw56572

Description: Low latency queueing (LLQ) does not drop packets after configuration changes. If the configured LLW burst size is changed in a policy map that is attached to an interface but the configured LLQ bandwidth is not changed, priority queueing (PQ) will stop dropping packets. If the traffic going through PQ is much greater than the configured bandwidth, the minimum bandwidth guarantees of the classes are not met.

Workaround: Remove and re-attach the service policy.



If you have an account with Cisco.com, you can use Bug Navigator II to find caveats of any severity for any release. To reach Bug Navigator II, log in to Cisco.com and click **Software Center: Cisco IOS Software: Bug Toolkit: Bug Navigator II**. Another option is to go to <a href="http://www.cisco.com/support/bugtools/">http://www.cisco.com/support/bugtools/</a>.

## **Related Documentation**

The following sections describe the documentation available for the Cisco Catalyst 4224 Access Gateway Switch. These documents consist of hardware and software installation guides, Cisco IOS configuration guides and command references, system error messages, and other documents.

Use these release notes with these documents:

- Platform-Specific Documents, page 8
- Cisco IOS Software Documentation Set, page 8.

#### **Platform-Specific Documents**

These documents are available for the Cisco Catalyst 4224 Access Gateway Switch on Cisco.com and on the Documentation CD-ROM:

- Catalyst 4224 Access Gateway Switch Software Configuration Guide
- Catalyst 4224 Access Gateway Switch Hardware Installation Guide
- Regulatory Safety and Compliance Information for Catalyst 4200 Series Access Gateway Switch

On Cisco.com at:

Products & Services: Switches: Cisco Catalyst 4200 Series Switches

On the Documentation CD-ROM or CCO at:

Cisco Product Documentation: Catalyst Switches: Catalyst 4224

#### **Cisco IOS Software Documentation Set**

The Cisco IOS software documentation set consists of the Cisco IOS configuration guides, Cisco IOS command references, and several other supporting documents. The Cisco IOS software documentation set is shipped with your order in electronic form on the Documentation CD-ROM, unless you specifically ordered the printed versions.



You can find the most current Cisco IOS documentation on Cisco.com.

On Cisco.com at:

Products & Services: IOS Software: Cisco IOS Software Releases 12.2

On the Documentation CD-ROM or CCO at:

Cisco Product Documentation: Cisco IOS Software Configuration: Cisco IOS Release 12.2: Configuration Guides and Command References

#### **Documentation Modules**

Each module in the Cisco IOS documentation set consists of one or more configuration guides and one or more corresponding command references. Chapters in a configuration guide describe protocols, configuration tasks, and Cisco IOS software functionality, and contain comprehensive configuration examples. Chapters in a command reference provide complete command syntax information. Use each configuration guide with its corresponding command reference.

#### **Cisco IOS Release 12.2 Documentation Set Contents**

Table 2 lists the contents of the Cisco IOS Release 12.2 software documentation set. These documents are available in electronic form and in printed form if ordered.

Table 2 Cisco IOS Release 12.2 Documentation Set

Books	Major Topics	
<ul> <li>Cisco IOS Configuration Fundamentals Configuration Guide</li> <li>Cisco IOS Configuration Fundamentals Command Reference</li> </ul>	File Management	
<ul> <li>Cisco IOS Bridging and IBM Networking Configuration Guide</li> <li>Cisco IOS Bridging and IBM Networking Command Reference, Volume 1 of 2</li> <li>Cisco IOS Bridging and IBM Networking Command Reference, Volume 2 of 2</li> </ul>	Transparent Bridging SRB Token Ring Inter-Switch Link Token Ring Route Switch Module RSRB DLSW+ Serial Tunnel and Block Serial Tunnel LLC2 and SDLC IBM Network Media Translation SNA Frame Relay Access NCIA Client/Server Airline Product Set DSPU and SNA Service Point SNA Switching Services Cisco Transaction Connection Cisco Mainframe Channel Connection CLAW and TCP/IP Offload CSNA, CMPC, and CMPC+ TN3270 Server	
Cisco IOS Dial Technologies Configuration Guide Cisco IOS Dial Technologies Command Reference  Cisco IOS Leafa Guide	Dial Access Modem and Dial Shelf Configuration and Management ISDN Configuration Signaling Configuration Point-to-Point Protocols Dial-on-Demand Routing Dial Backup Dial Related Addressing Service Network Access Solutions Large-Scale Dial Solutions Cost-Control Solutions Internetworking Dial Access Scenarios	
<ul> <li>Cisco IOS Interface Configuration Guide</li> <li>Cisco IOS Interface Command Reference</li> </ul>	LAN Interfaces Serial Interfaces Logical Interfaces	

Table 2 Cisco IOS Release 12.2 Documentation Set (continued)

Books	Major Topics	
<ul> <li>Cisco IOS IP Configuration Guide</li> <li>Cisco IOS IP Command Reference, Volume 1 of 3: Addressing and Services</li> <li>Cisco IOS IP Command Reference, Volume 2 of 3: Routing Protocols</li> <li>Cisco IOS IP Command Reference, Volume 3 of 3: Multicast</li> </ul>	IP Addressing IP Services IP Routing Protocols IP Multicast	
<ul> <li>Cisco IOS AppleTalk and Novell IPX Configuration Guide</li> <li>Cisco IOS AppleTalk and Novell IPX Command Reference</li> <li>Cisco IOS Apollo Domain, Banyan VINES, DECnet,</li> </ul>	AppleTalk Novell IPX Apollo Domain	
<ul> <li>ISO CLNS, and XNS Configuration Guide</li> <li>Cisco IOS Apollo Domain, Banyan VINES, DECnet, ISO CLNS, and XNS Command Reference</li> </ul>	Banyan VINES DECnet ISO CLNS XNS	
<ul> <li>Cisco IOS Voice, Video, and Fax Configuration Guide</li> <li>Cisco IOS Voice, Video, and Fax Command Reference</li> </ul>	Voice over IP Call Control Signaling Voice over Frame Relay Voice over ATM Telephony Applications Trunk Management Fax, Video, and Modem Support	
<ul> <li>Cisco IOS Quality of Service Solutions Configuration Guide</li> <li>Cisco IOS Quality of Service Solutions Command Reference</li> </ul>	Packet Classification Congestion Management Congestion Avoidance Policing and Shaping Signaling Link Efficiency Mechanisms	
<ul> <li>Cisco IOS Security Configuration Guide</li> <li>Cisco IOS Security Command Reference</li> </ul>	AAA Security Services Security Server Protocols Traffic Filtering and Firewalls IP Security and Encryption Passwords and Privileges Neighbor Router Authentication IP Security Options Supported AV Pairs	
<ul> <li>Cisco IOS Switching Services Configuration Guide</li> <li>Cisco IOS Switching Services Command Reference</li> </ul>	Cisco IOS Switching Paths NetFlow Switching Multiprotocol Label Switching Multilayer Switching Multicast Distributed Switching Virtual LANs LAN Emulation	
<ul> <li>Cisco IOS Wide-Area Networking Configuration Guide</li> <li>Cisco IOS Wide-Area Networking Command Reference</li> </ul>	ATM Frame Relay SMDS X.25 and LAPB	

Table 2 Cisco IOS Release 12.2 Documentation Set (continued)

Books	Major Topics	
Cisco IOS Mobile Wireless Configuration Guide	General Packet Radio Service	
<ul> <li>Cisco IOS Mobile Wireless Command Reference</li> </ul>		
Cisco IOS Terminal Services Configuration Guide	ARA	
Cisco IOS Terminal Services Command Reference	LAT	
- Cisco 103 Terminai Services Commana Rejerence	NASI	
	Telnet	
	TN3270	
	XRemote	
	X.28 PAD	
	Protocol Translation	

- · Cisco IOS Configuration Guide Master Index
- Cisco IOS Command Reference Master Index
- · Cisco IOS Debug Command Reference
- Cisco IOS Software System Error Messages
- New Features in 12.2-Based Limited Lifetime Releases
- New Features in Release 12.2 T
- Release Notes (Release note and caveat documentation for 12.2-based releases and various platforms)

# **Obtaining Documentation**

These sections explain how to obtain documentation from Cisco Systems.

#### World Wide Web

You can access the most current Cisco documentation on the World Wide Web at this URL:

http://www.cisco.com

Translated documentation is available at this URL:

http://www.cisco.com/public/countries\_languages.shtml

#### **Documentation CD-ROM**

Cisco documentation and additional literature are available in a Cisco Documentation CD-ROM package, which is shipped with your product. The Documentation CD-ROM is updated monthly and may be more current than printed documentation. The CD-ROM package is available as a single unit or through an annual subscription.

## **Ordering Documentation**

You can order Cisco documentation in these ways:

 Registered Cisco.com users (Cisco direct customers) can order Cisco product documentation from the Networking Products MarketPlace:

http://www.cisco.com/cgi-bin/order/order\_root.pl

 Registered Cisco.com users can order the Documentation CD-ROM through the online Subscription Store:

http://www.cisco.com/go/subscription

 Nonregistered Cisco.com users can order documentation through a local account representative by calling Cisco Systems Corporate Headquarters (California, U.S.A.) at 408 526-7208 or, elsewhere in North America, by calling 800 553-NETS (6387).

#### **Documentation Feedback**

You can submit comments electronically on Cisco.com. In the Cisco Documentation home page, click the **Fax** or **Email** option in the "Leave Feedback" section at the bottom of the page.

You can e-mail your comments to bug-doc@cisco.com.

You can submit your comments by mail by using the response card behind the front cover of your document or by writing to the following address:

Cisco Systems Attn: Document Resource Connection 170 West Tasman Drive San Jose, CA 95134-9883

We appreciate your comments.

# **Obtaining Technical Assistance**

Cisco provides Cisco.com as a starting point for all technical assistance. Customers and partners can obtain online documentation, troubleshooting tips, and sample configurations from online tools by using the Cisco Technical Assistance Center (TAC) Web Site. Cisco.com registered users have complete access to the technical support resources on the Cisco TAC Web Site.

#### Cisco.com

Cisco.com is the foundation of a suite of interactive, networked services that provides immediate, open access to Cisco information, networking solutions, services, programs, and resources at any time, from anywhere in the world.

Cisco.com is a highly integrated Internet application and a powerful, easy-to-use tool that provides a broad range of features and services to help you with these tasks:

- Streamline business processes and improve productivity
- · Resolve technical issues with online support
- · Download and test software packages

- Order Cisco learning materials and merchandise
- · Register for online skill assessment, training, and certification programs

If you want to obtain customized information and service, you can self-register on Cisco.com. To access Cisco.com, go to this URL:

http://www.cisco.com

#### **Technical Assistance Center**

The Cisco Technical Assistance Center (TAC) is available to all customers who need technical assistance with a Cisco product, technology, or solution. Two levels of support are available: the Cisco TAC Web Site and the Cisco TAC Escalation Center.

Cisco TAC inquiries are categorized according to the urgency of the issue:

- Priority level 4 (P4)—You need information or assistance concerning Cisco product capabilities, product installation, or basic product configuration.
- Priority level 3 (P3)—Your network performance is degraded. Network functionality is noticeably impaired, but most business operations continue.
- Priority level 2 (P2)—Your production network is severely degraded, affecting significant aspects of business operations. No workaround is available.
- Priority level 1 (P1)—Your production network is down, and a critical impact to business operations will occur if service is not restored quickly. No workaround is available.

The Cisco TAC resource that you choose is based on the priority of the problem and the conditions of service contracts, when applicable.

#### Cisco TAC Web Site

You can use the Cisco TAC Web Site to resolve P3 and P4 issues yourself, saving both cost and time. The site provides around-the-clock access to online tools, knowledge bases, and software. To access the Cisco TAC Web Site, go to this URL:

http://www.cisco.com/tac

All customers, partners, and resellers who have a valid Cisco service contract have complete access to the technical support resources on the Cisco TAC Web Site. The Cisco TAC Web Site requires a Cisco.com login ID and password. If you have a valid service contract but do not have a login ID or password, go to this URL to register:

http://www.cisco.com/register/

If you are a Cisco.com registered user, and you cannot resolve your technical issues by using the Cisco TAC Web Site, you can open a case online by using the TAC Case Open tool at this URL:

http://www.cisco.com/tac/caseopen

If you have Internet access, we recommend that you open P3 and P4 cases through the Cisco TAC Web Site.

#### **Cisco TAC Escalation Center**

The Cisco TAC Escalation Center addresses priority level 1 or priority level 2 issues. These classifications are assigned when severe network degradation significantly impacts business operations. When you contact the TAC Escalation Center with a P1 or P2 problem, a Cisco TAC engineer automatically opens a case.

To obtain a directory of toll-free Cisco TAC telephone numbers for your country, go to this URL:

http://www.cisco.com/warp/public/687/Directory/DirTAC.shtml

Before calling, please check with your network operations center to determine the level of Cisco support services to which your company is entitled: for example, SMARTnet, SMARTnet Onsite, or Network Supported Accounts (NSA). When you call the center, please have available your service agreement number and your product serial number.

This document is to be used in conjunction with the documents listed in the "Related Documentation" section.

CCIP, the Cisco Arrow logo, the Cisco *Powered* Network mark, the Cisco Systems Verified logo, Cisco Unity, Follow Me Browsing, FormShare, iQ Breakthrough, iQ Expertise, iQ FastTrack, the iQ Logo, iQ Net Readiness Scorecard, Networking Academy, ScriptShare, SMARTnet, TransPath, and Voice LAN are trademarks of Cisco Systems, Inc.; Changing the Way We Work, Live, Play, and Learn, Discover All That's Possible, The Fastest Way to Increase Your Internet Quotient, and iQuick Study are service marks of Cisco Systems, Inc.; and Aironet, ASIST, BPX, Catalyst, CCDA, CCDP, CCIE, CCNA, CCNP, Cisco, the Cisco Certified Internetwork Expert logo, Cisco IOS, the Cisco IOS logo, Cisco Press, Cisco Systems, Cisco Systems Capital, the Cisco Systems logo, Empowering the Internet Generation, Enterprise/Solver, EtherChannel, EtherSwitch, Fast Step, GigaStack, Internet Quotient, IOS, IP/TV, LightStream, MGX, MICA, the Networkers logo, Network Registrar, *Packet*, PIX, Post-Routing, Pre-Routing, RateMUX, Registrar, SdideCast, StrataView Plus, Stratm, SwitchProbe, TeleRouter, and VCO are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the U.S. and certain other countries.

All other trademarks mentioned in this document or Web site are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (0208R)

Copyright © 2002, Cisco Systems, Inc. All rights reserved.